


DALLAS DHU DRY ROT WORKS




Kiln and Malting floor gable end.

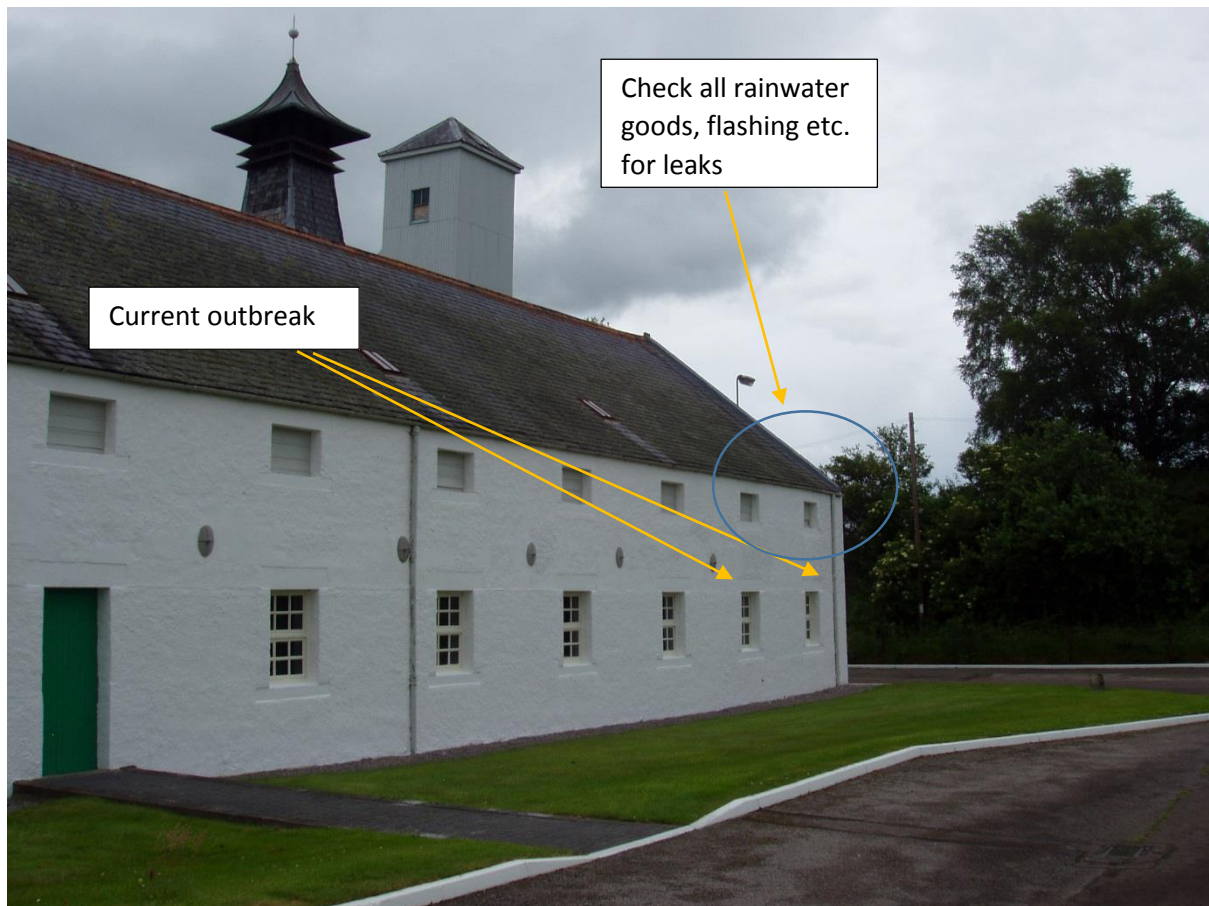

Malting floor outbreak



Lintel of large kiln window (note old fruiting body). Break out rotten lintel and reinstate with treated timber coated with Boron, locally rebuild masonry and slaister to match as required.

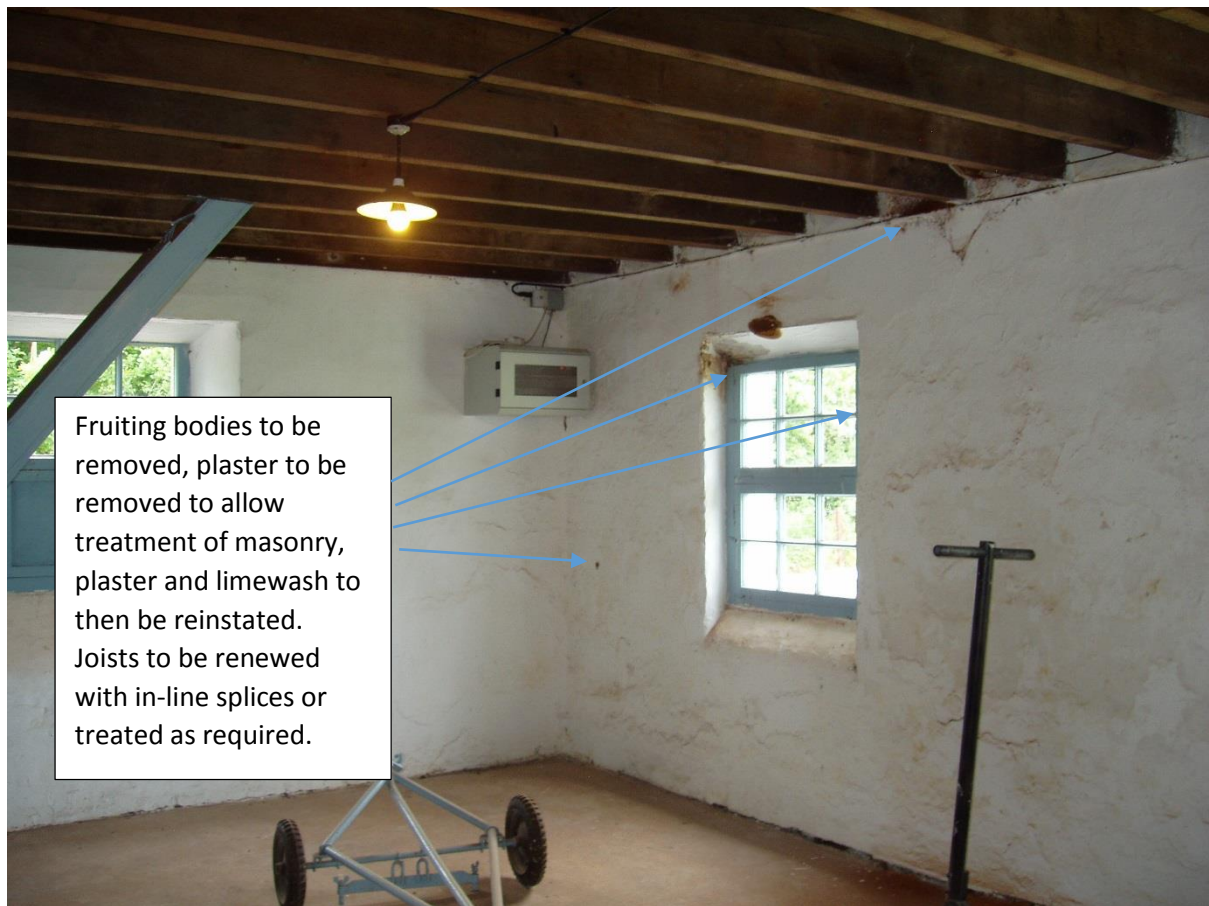

Fruiting bodies to be removed, plaster to be removed to allow treatment of masonry, plaster and limewash to then be reinstated. Joists to be renewed with in-line splices or treated as required.

Malting floor.



Malting floor fruiting bodies. Plaster needs to be removed to allow access to replace timbers as required and treat masonry, then Lime plaster will be re-applied and limewashed.



Barley Loft above malting floor. Plaster to be removed to allow access to rafters for treatment or renewal (in line splice). Louvred vent frames can hopefully be treated and retained. MCU to re-plaster and limewash on completion.